GROUP 5[®]

G20 Family 20A 125V Stage Pin Wiring Instructions

- Use #10 or #12 Type S multiconductor cable.
- Strip the conductors 3/8"
- Two versions of wire termination are available.
- 1. Slide wire shoe (ferrule) over each wire and insert into appropriate terminal pocket.
 - -Green wire into terminal marked "G"
 - -White wire into terminal marked "N"
 - -Black wire into terminal marked "H"
 - -Tighten each #8-32 set screws to 12 in-lbs. torque.
- 2. Crimp a #8 ring terminal onto each wire.
 - -Green wire to terminal marked "G"
 - -White wire to terminal marked "N"
 - -Black wire to terminal marked "H"
 - -Place washer over ring terminal.
 - -Attach to the appropriate terminal with the #8-32 terminal screw at 12 in-lbs torque.
- Place cover over housing and tighten the three #8-32 flat head screws to 14 in-lbs. torque.
- Device is now ready for use.

GROUP 5[®]

G20 Family 20A 125V Stage Pin Wiring Instructions

- Use #10 or #12 Type S multiconductor cable.
- Strip the conductors 3/8"
- Two versions of wire termination are available.
- 1. Slide wire shoe (ferrule) over each wire and insert into appropriate terminal pocket.
 - -Green wire into terminal marked "G"
 - -White wire into terminal marked "N"
 - -Black wire into terminal marked "H"
 - -Tighten each #8-32 set screws to 12 in-lbs. torque.
- 2. Crimp a #8 ring terminal onto each wire.
 - -Green wire to terminal marked "G"
 - -White wire to terminal marked "N"
 - -Black wire to terminal marked "H"
 - -Place washer over ring terminal.
 - -Attach to the appropriate terminal with the #8-32 terminal screw at 12 in-lbs torque.
- Place cover over housing and tighten the three #8-32 flat head screws to 14 in-lbs. torque.
- · Device is now ready for use.

G20 Family 20A 125V Stage Pin Wiring Instructions

GROUP 5®

- Use #10 or #12 Type S multiconductor cable.
- Strip the conductors 3/8"
- Two versions of wire termination are available.
- 1. Slide wire shoe (ferrule) over each wire and insert into appropriate terminal pocket.
 - -Green wire into terminal marked "G"
 - -White wire into terminal marked "N"
 - -Black wire into terminal marked "H"
 - -Tighten each #8-32 set screws to 12 in-lbs. torque.
- 2. Crimp a #8 ring terminal onto each wire.
 - -Green wire to terminal marked "G"
 - -White wire to terminal marked "N"
 - -Black wire to terminal marked "H"
 - -Place washer over ring terminal.
 - -Attach to the appropriate terminal with the #8-32 terminal screw at 12 in-lbs torque.
- Place cover over housing and tighten the three #8-32 flat head screws to 14 in-lbs. torque.
- Device is now ready for use.