

GROUP 5®

G60 Family 60A 125V Stage Pin Wiring Instructions

- Use #6 Type SC single conductor cable, or use 6/3 or 8/3 Type W multiconductor cable.
 - When using Type SC cable, use gaffers tape to secure the three wires together in a bundle where they pass through the housing at the strain relief.
 - For applications needing 4/3 S-jacketed cable, use G60M-DB or G60F-DB which has a wider jacket opening.
 - Strip the conductors 3/4".
 - Two versions of wire termination are available.
1. Slide wire shoe (ferrule) over each wire and insert into appropriate terminal pocket.
 - Green wire into terminal marked "G"
 - White wire into terminal marked "N"
 - Black wire into terminal marked "H"
 - Tighten #10-24 double set screws to 20 in-lbs torque with 3/32" hex (allen) head wrench.
 2. Crimp a #10 ring terminal onto each wire.
 - Green wire to terminal marked "G"
 - White wire to terminal marked "N"
 - Black wire to terminal marked "H"
 - Place washer over ring terminal.
 - Attach to the appropriate terminal with the #10-24 terminal screw at 20 in-lbs torque.
- Place cover over housing and tighten the three ¼"-20 flat head screws to 14 in-lbs. torque.
 - Device is now ready for use.

GROUP 5®

G60 Family 60A 125V Stage Pin Wiring Instructions

- Use #6 Type SC single conductor cable, or use 6/3 or 8/3 Type W multiconductor cable.
 - When using Type SC cable, use gaffers tape to secure the three wires together in a bundle where they pass through the housing at the strain relief.
 - For applications needing 4/3 S-jacketed cable, use G60M-DB or G60F-DB which has a wider jacket opening.
 - Strip the conductors 3/4".
 - Two versions of wire termination are available.
1. Slide wire shoe (ferrule) over each wire and insert into appropriate terminal pocket.
 - Green wire into terminal marked "G"
 - White wire into terminal marked "N"
 - Black wire into terminal marked "H"
 - Tighten #10-24 double set screws to 20 in-lbs torque with 3/32" hex (allen) head wrench.
 2. Crimp a #10 ring terminal onto each wire.
 - Green wire to terminal marked "G"
 - White wire to terminal marked "N"
 - Black wire to terminal marked "H"
 - Place washer over ring terminal.
 - Attach to the appropriate terminal with the #10-24 terminal screw at 20 in-lbs torque.
- Place cover over housing and tighten the three ¼"-20 flat head screws to 14 in-lbs. torque.
 - Device is now ready for use.

GROUP 5®

G60 Family 60A 125V Stage Pin Wiring Instructions

- Use #6 Type SC single conductor cable, or use 6/3 or 8/3 Type W multiconductor cable.
 - When using Type SC cable, use gaffers tape to secure the three wires together in a bundle where they pass through the housing at the strain relief.
 - For applications needing 4/3 S-jacketed cable, use G60M-DB or G60F-DB which has a wider jacket opening.
 - Strip the conductors 3/4".
 - Two versions of wire termination are available.
1. Slide wire shoe (ferrule) over each wire and insert into appropriate terminal pocket.
 - Green wire into terminal marked "G"
 - White wire into terminal marked "N"
 - Black wire into terminal marked "H"
 - Tighten #10-24 double set screws to 20 in-lbs torque with 3/32" hex (allen) head wrench.
 2. Crimp a #10 ring terminal onto each wire.
 - Green wire to terminal marked "G"
 - White wire to terminal marked "N"
 - Black wire to terminal marked "H"
 - Place washer over ring terminal.
 - Attach to the appropriate terminal with the #10-24 terminal screw at 20 in-lbs torque.
- Place cover over housing and tighten the three ¼"-20 flat head screws to 14 in-lbs. torque.
 - Device is now ready for use.

MARINCO

marinco.com
Tech Support and Customer Service
800.307.6702

PN 202658 0315

MARINCO

marinco.com
Tech Support and Customer Service
800.307.6702

PN 202658 0315

MARINCO

marinco.com
Tech Support and Customer Service
800.307.6702

PN 202658 0315